

SONY® Service Bulletin

NO: ME3-99-010

SUBJECT: ROTARY ENCODER VOLUME MAY NOT WORK

DATE: MAY 1999


MODEL (S): MDX-C670/C7900/C8900

SYMPTOM: The operating volume may not be adjusted, or randomly changes. This may be caused by contact failure of rotary encoder that adjusts volume.

SOLUTION: If this condition exists or customer complaint is this symptom then, replace the rotary encoder with an improved one. Please indicate what month and year the encoder was manufactured. All encoders produced before November 1998 are subject to failure.

Please use illustration to verify lot number.

DESCRIPTION	PART NUMBER
ROTARY ENCODER	1-475-014-12

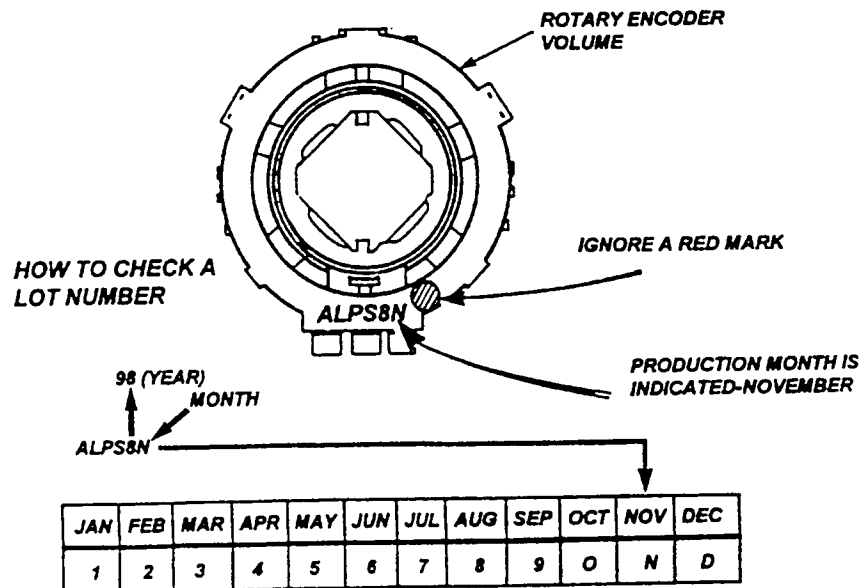

SONAM 461
ME98035

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE